



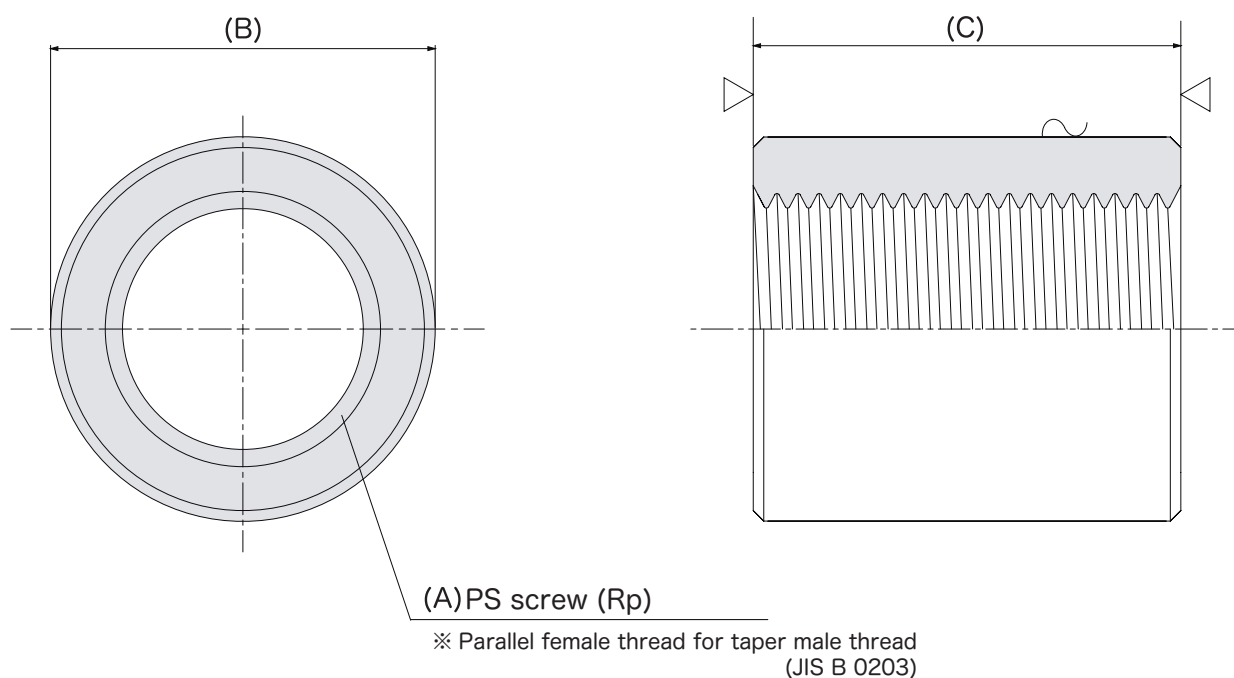

## 【Detailed view of screw】

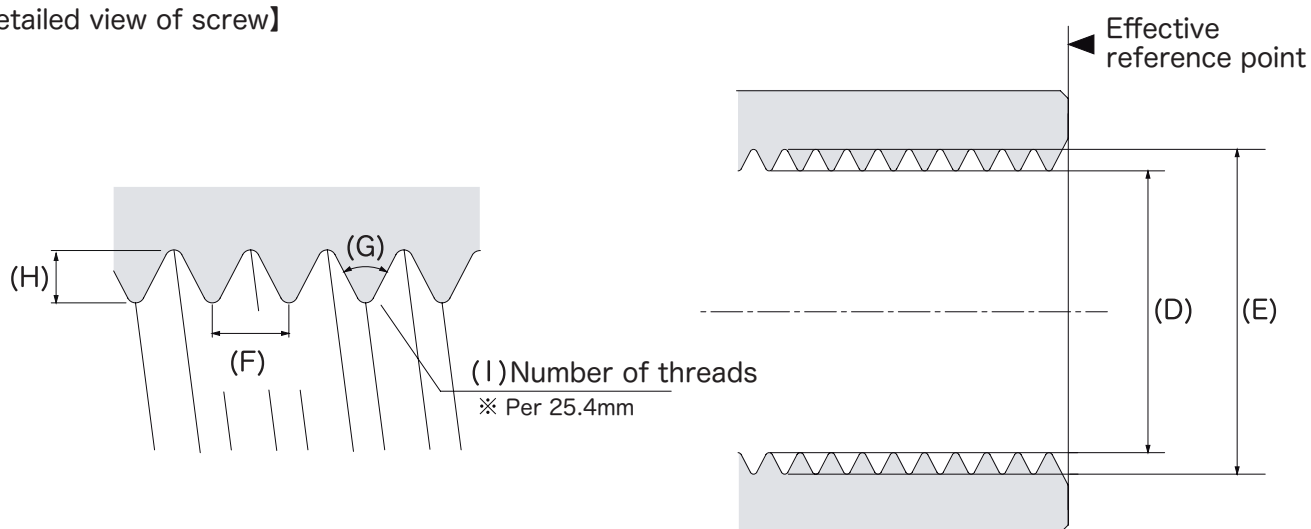

※ Dimensional unit is mm

| A | Size                                | 6A | 8A     | 10A    | 15A    | 20A    | 25A    | 32A    | 40A    | 50A    | 65A | 80A | 100A |
|---|-------------------------------------|----|--------|--------|--------|--------|--------|--------|--------|--------|-----|-----|------|
| B | Outer diameter( $\Phi$ )            |    | 19     | 23     | 28     | 34.5   | 41.5   | 51     | 58     | 70     |     |     |      |
| C | length                              |    | 27     | 28     | 37     | 39     | 46     | 51     | 51     | 60     |     |     |      |
| D | Effective diameter( $\Phi$ )        |    | 11.445 | 14.95  | 18.631 | 24.117 | 30.291 | 38.952 | 44.845 | 56.656 |     |     |      |
| E | Effective valley diameter( $\Phi$ ) |    | 13.157 | 16.662 | 20.955 | 26.441 | 33.249 | 41.91  | 47.803 | 59.614 |     |     |      |
| F | Screw pitch                         |    | 1.3368 | 1.3368 | 1.8143 | 1.8143 | 2.3091 | 2.3091 | 2.3091 | 2.3091 |     |     |      |
| G | Thread angle                        |    | 55°    | 55°    | 55°    | 55°    | 55°    | 55°    | 55°    | 55°    |     |     |      |
| H | Thread height                       |    | 0.856  | 0.856  | 1.162  | 1.162  | 1.479  | 1.479  | 1.479  | 1.479  |     |     |      |
| I | Number of threads                   |    | 19     | 19     | 14     | 14     | 11     | 11     | 11     | 11     |     |     |      |